

Input data

System of measurement		Metric
Input type		Gear motor
Input speed	[rpm]	1400
Output speed	[rpm]	0.25
Ratio (i=)		5600
Frequency	[Hz]	50
Input options		IEC
Requested input power	[kW]	0.06
Service factor		0.7
Rated Power P1	[kW]	0.04

Warning! The torque generated by the selected motor is above the gearbox rated output torque; please refer to the gearbox rated output torque.

Output data

Gear unit	M RS/RS 40/70 S (bolted) 11 5600 56 B5 AC 28 MT 0.06 kW 56 A4 B5 X3 B3
------------------	---

Type		RS/RS - Worm speed reducers
Input type		M
Size		40/70
Ratio (i=)		5600
Gearbox ratio		56.00
Pre-stage ratio		100.00
Input flange		B5
Mounting position		B3
Input speed	[rpm]	1400
Output speed	[rpm]	0.25
Rated output torque	[Nm]	321
Service Factor		0.7
Efficiency		0.2

Gear unit configuration

Output shaft		Hollow output shaft
Fixing		Feet
Version		S (bolted)
Attachment position		11

Output radial and axial loads

Ball bearings output radial load	[N]	6700
Taper bearings output radial load	[N]	7900
Ball bearings output axial load	[N]	1340
Taper bearings output axial load	[N]	1580

Accessories



Hollow output shaft		AC 28
---------------------	--	-------

Electric motor




Size		56 A4
Poles		4
Power	[kW]	0.06

Electric motor configuration


Motor flange		B5
Terminal box position		X3

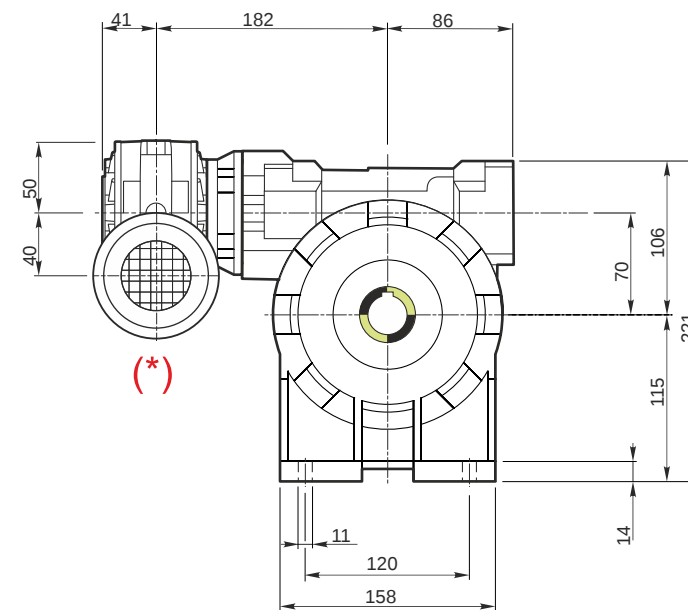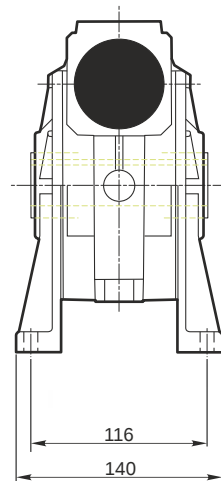


Hollow output shaft

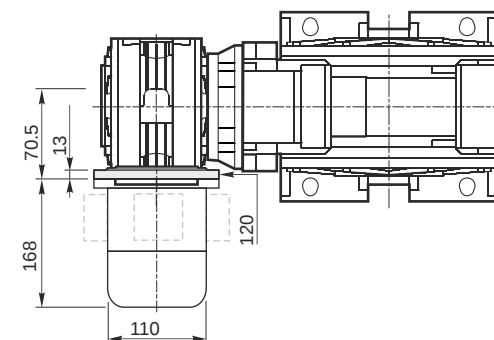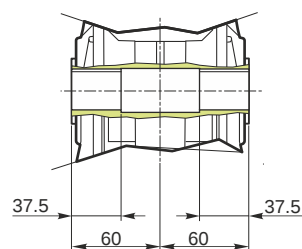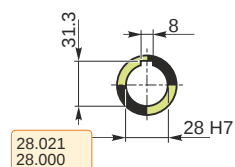


Mounting positions

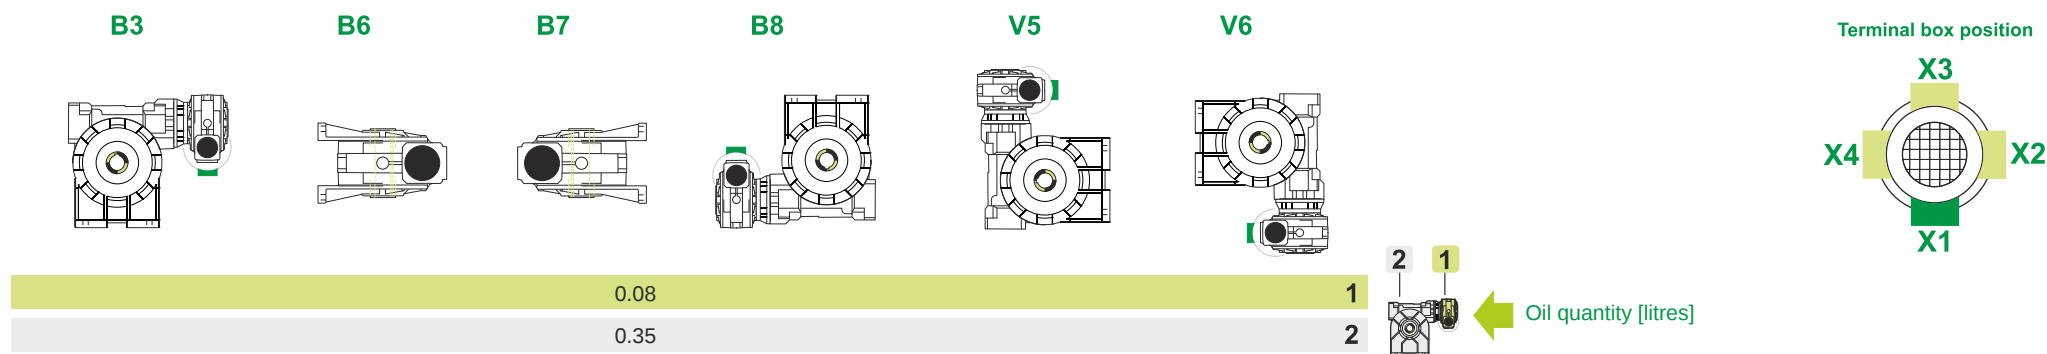

Attachment position

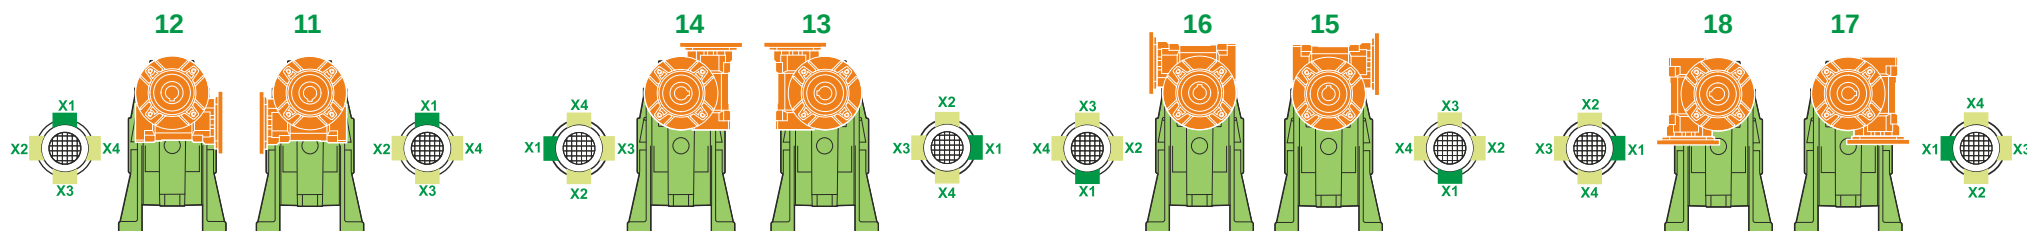

Direction of rotation

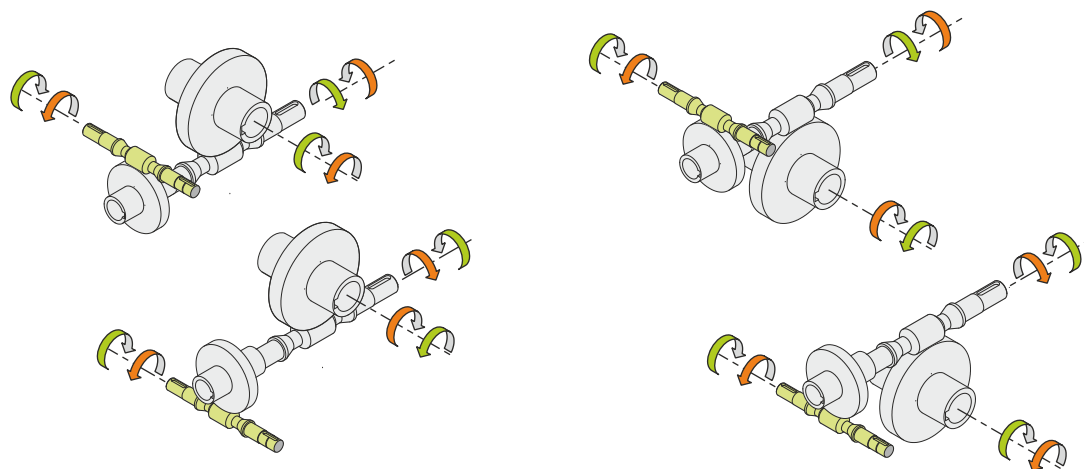

Weight

Gear unit [kg]	12
Electric motor [kg]	2.6

Gearing data 2

Axial module	2
Number of starts	1
Lead angle	4° 05'
Pressure angle	

Backdriving

- Static self-locking
- No back-driving
- No dynamic back-driving

M RS/RS 40/70 S (bolted) 11 5600 56 B5 AC 28 MT 0.06 kW 56 A4 B5 X3 B3